

Related Service Parts - NDV4236IL-B


Date Printed 2022-01-19

NOVUS DV FIREPLACE LP IPI

Beginning Manufacturing Date 2016-02-01

Ending Manufacturing Date 2020-10-05

Log Set Assembly

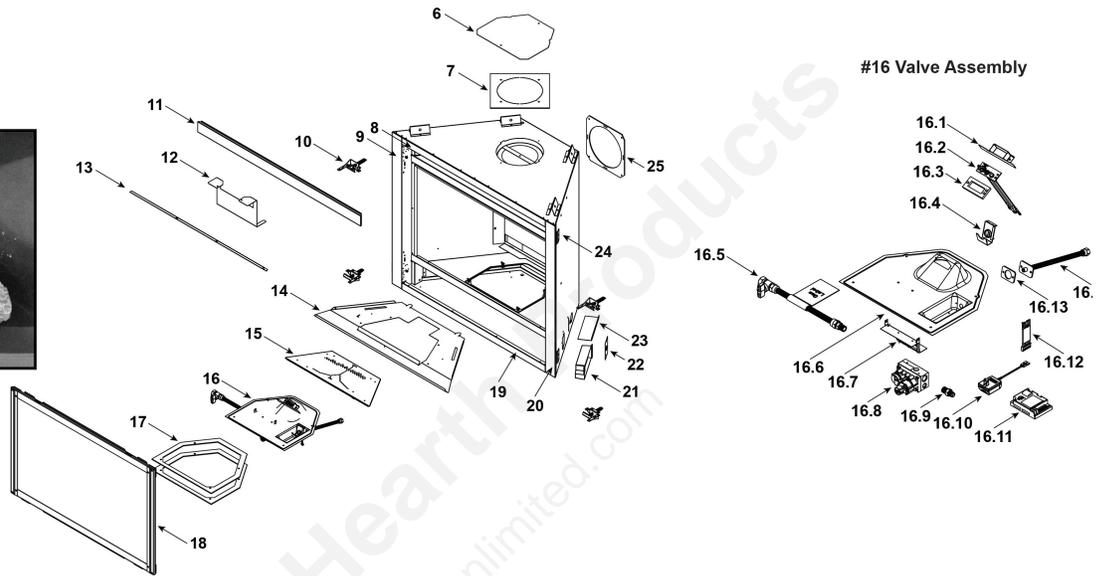

Item #	Description	Comments	Service Part	Volume	Weight	Qty Per Package	Stocked At Depot	MSRP USD
	LOG SET ASSEMBLY		SRV2382-070	2.889	10.000	1	Y	\$311.00
4	ASSY, TOP LOG		SRV2382-074	0.500	2.000	1	N	\$62.00
5	ASSY, MIDDLE LOG		SRV2380-075	0.500	1.000	1	N	\$59.00
6	INTAKE COVER PLATE		2166-450	0.029	0.500	1	14	\$12.00
7	INTAKE COVER GASKET		4031-239	0.070	0.700	1	14	\$6.00
8	FRONT FACE 36*	Not replaceable, must order overlay (CUST4018-001)	4055-196			1	N	**
9	SIDE COLUMN	Not replaceable, must order overlay (CUST4018-001)	4055-133			1	N	**
10	GLASS CLIP SUPPORT ASSY	Qty 4 req	2382-400	0.243	1.000	1	14	\$11.00
11	DRYWALL LIP 36*		4031-207	0.425	4.000	1	14	\$14.00
12	EXHAUST BAFFLE		2382-129	0.926	1.000	1	14	\$14.00
13	GLASS SHIELD 36*		4031-219	0.000	3.300	1	14	\$14.00
14	36* HEARTH PAN		2382-111	2.771	6.000	1	14	\$40.00
15	36* BURNER PAN ASSY		2382-007	1.625	10.000	1	Y	\$70.00
17	VALVE GASKET	Qty 2 req	4055-135	0.200	1.000	1	14	\$9.00
18	GLASS ASSEMBLY, 36*		GLA2382-018	1.806	14.000	1	7	\$277.00
21	JUNCTION BOX (PLASTIC)		SRV4021-013	0.093	2.000	1	Y	\$24.00
22	JUNC BOX COVER PLATE		SRV4031-222	0.028	1.000	1	14	\$6.00
23	JBOX RADIATION SHIELD		4031-193	0.000	0.500	1	14	\$6.00
24	NAILING FLANGE	Qty 4 req	SRV4044-161	0.057	1.000	1	8	\$6.00
25	FLUE GASKET		SRV4000-225	0.028	1.000	1	8	\$6.00

	FIREBOX TOUCH UP PAINT		SRV4021-110	0.240	2.000	1	N	\$52.00
	TOUCH UP PAINT,BLACK		TUP-GBK-12	0.500	1.000	1	28	\$26.00
	CORD CLIP		14218†	0.000		1	N	**
	BATTERY PACK		SRV593-594	0.056	1.000	1	Y	\$7.00
	SCREW 8-32X1-1/2 THUMB ZN	Pkg of 25	4021-558/25	0.100	1.000	25	Y	\$16.00
	LAVA ROCK BAG ASSEMBLY		4040-094	0.000	5.250	1	N	\$13.00
	LAVA ROCK 3 LBS		4021-297	0.094	3.000	1	N	\$11.00
	MINERAL WOOL		SRV14333	0.014	1.000	1	N	\$9.00
	SURROUND BOTTOM ASSY LG		28476†			1	N	**
16.2	PILOT ASSEMBLY, NG		SRV2090-012	0.028	0.250	1	Y	\$37.00
16.2	PILOT ASSEMBLY LP		2090-013	0.729	1.000	1	Y	\$36.00
16.3	PILOT GASKET		4021-042	0.000	0.050	1	N	\$5.00
16.4	AIR SHUTTER ASY SERVICE		SRV4055-202	0.028	1.000	1	Y	\$6.00
16.5	12* FLEX BALL VALVE ASSY		SRV302-320	0.028	1.000	1	Y	\$37.00
16.6	SEAL PLATE ASY		2382-584	1.122	4.000	1	14	\$30.00
16.7	VALVE BRACKET		4055-205	0.100	0.100	1	14	\$5.00
16.7	VALVE, NG VARIABLE		750-500	0.250	1.250	1	Y	\$98.00
16.8	LP VARIABLE VALVE, NP		2155-501	0.125	1.000	1	Y	\$184.00
16.9	MALE CONNECTOR PKG 5	Pkg of 5	303-315/5	0.100	0.500	5	60	\$21.00
16.10	3V TRANSFORMER		SRV593-593	0.056	2.000	1	Y	\$15.00
16.11	CONTROL MODULE DEXEN		SRV593-592	0.100		1	Y	\$65.00
16.12	WIRE ASSEMBLY		SRV593-590	0.028	1.000	1	Y	\$22.00
16.13	BULKHEAD GASKET		4021-429	0.000	1.000	1	8	\$5.00
16.14	BULKHEAD FLEXIBLE		4021-512	0.025	2.000	1	Y	\$33.00
	THERMOSTAT WIRE		SRV2118-170	0.028	1.000	1	Y	\$15.00
	Burner Orifice,NG (#42C)		582-842	0.029	0.050	1	Y	\$5.00
	ORIFICE #54 C		SRV582-854	0.014	1.000	1	Y	\$6.00
	CONVERSION KIT FOR NOVUS		DCKVN-NOVUS	0.243	2.000	1	Y	\$148.00
	LP conversion kit for IntelliFire		DCKVP-NOVUS	0.000	0.500	1	Y	\$95.00
	ORIFICE PILOT NG		SRV593-528	0.014	1.000	1	Y	\$10.00
	ORIFICE PILOT LP		SRV593-527	0.014	1.000	1	Y	\$12.00
	REGULATOR, NG		SRVNGK-DXV	0.056	2.000	1	Y	\$61.00
	REGULATOR, LP	Not Available, must replace valve	SRVLPK-DXV	0.056	2.000	1	Y	\$61.00

** Pricing not available because of one of the following: Not able to calculate - please contact person who sets pricing for your company, part not available to order or distributor needs to provide your pricing directly to you.

† Denotes discontinued product.